



Standard Practice for Evaluating Adhesion of Installed Weatherproofing Sealant Joints¹

This standard is issued under the fixed designation C 1521; the number immediately following the designation indicates the year of original adoption or, in the case of revision, the year of last revision. A number in parentheses indicates the year of last reapproval. A superscript epsilon (ε) indicates an editorial change since the last revision or reapproval.

1. Scope

1.1 This practice describes field tests to determine the adhesive and cohesive characteristics of an installed sealant joint, by manually placing a strain on the sealant. The sealant to be tested shall be fully cured. The results of this method can be used in conjunction with other information to determine the overall performance of the sealant joint. The user of this practice should define the other parameters to be evaluated such as cleaning of the substrate, depth control of the sealant, sealant profile, etc. This method describes both nondestructive and destructive procedures.

1.2 The destructive procedure stresses the sealant in such a way as to cause either cohesive or adhesive failure of the sealant or cohesive failure of the substrate where deficient substrate conditions exist. The objective is to characterize the adhesive/cohesive performance of the sealant on the specific substrate by applying whatever strain is necessary to effect failure of the sealant bead. It is possible that the strain applied to the sealant bead may result in the failure of a deficient substrate before effecting a failure in the sealant.

NOTE 1—The destructive procedure requires immediate repair of the sealant bead. Appropriate materials and equipment should be available for this purpose.

NOTE 2—Sealant formulations may fail in cohesion or adhesion when properly installed, and tested by this method. The sealant manufacturer should be consulted to determine the appropriate guidelines for using this method.

1.3 The nondestructive procedure places strain on the sealant and a stress on the adhesive bond. Though termed nondestructive, this procedure may result in an adhesive failure of a deficient sealant bead, but should not cause a cohesive failure in the sealant. The results of this procedure should be either adhesive failure or no failure.

NOTE 3—The nondestructive procedure may require immediate repair of the sealant bead, if failure is experienced. Appropriate materials and equipment should be available for this purpose.

1.4 The committee with jurisdiction over this practice is not aware of any comparable practices published by other organizations or committees.

1.5 *This standard does not purport to address all of the safety concerns, if any, associated with its use. It is the responsibility of the user of this standard to establish appropriate safety and health practices and determine the applicability of regulatory limitations prior to use.*

2. Referenced Documents

2.1 ASTM Standards:

C 717 Terminology of Building Seals and Sealants²

3. Terminology

3.1 *Definitions*—For definitions of terms used in this recommended procedure, see Terminology C 717.

3.2 Definitions of Terms Specific to This Standard:

3.2.1 *flap, n*—the term “flap” as used in this specification refers to a portion of an installed sealant bead that has been purposely cut along one substrate bond line and across the bead at two locations resulting in a portion of bead adhered along one substrate bond line.

3.2.2 *tail, n*—the term “tail” as used in this specification refers to a portion of an installed sealant bead that has been purposely cut along both substrate bond lines and across the bead at one location resulting in a portion of bead unadhered to the substrates but adhered to the remainder of the sealant bead.

4. Significance and Use

4.1 Many parameters contribute to the overall performance of a sealant application. Some of the most significant parameters are sealant bead size and configuration, joint movement, quality of workmanship, the quality of the adhesive bond, and the quality of the sealant material.

4.2 A sealant usually fails to perform as a weatherseal when it experiences cohesive or adhesive failure.

4.3 If a sealant bead fails, an evaluation of the total joint movement may be needed to determine if the joint sealant was strained beyond design or if the sealant failed within design parameters.

¹ This practice is under the jurisdiction of ASTM Committee C24 on Building Seals and Sealants and is the direct responsibility of Subcommittee C24.30 on Adhesion.

Current edition approved May 10, 2002. Published July 2002. Originally published as C 1521 – 02. Last previous edition C 1521 – 02.

² *Annual Book of ASTM Standards*, Vol 04.07.

4.4 If a sealant bead fails adhesively, there is no straightforward procedure for determining the cause. The adhesive failure may be due to workmanship, the specific surface preparation used, the specific sealant used, poor “installed” joint design, poor bond chemistry and other causes.

4.5 Because of the complex nature of the performance of a sealant bead, an understanding of the quality of the adhesive bond is instrumental in any evaluation of sealant performance. It is critical that the test procedures used truly evaluate the quality of the adhesive bond and do not simply take advantage of the tear resistance of the sealant.

4.6 This method does not evaluate the performance of a sealant joint as a weatherseal. It only evaluates the characteristics of the adhesive bond relative to the cohesive strength of the sealant in a particular installation. Since any failures that result from use of this test method are intentionally induced, they do not necessarily mean that the sealant joint will not perform as a weatherseal.

4.7 The method results are most useful in identifying sealant joints with poor adhesion. The results of these methods can be used to assess the likely performance of the sealant joint and to compare performance against other joints.

5. Testing Equipment

5.1 *Field Equipment*—The following equipment is required to perform this practice: rule with $\frac{1}{32}$ in. divisions (mm), probing tool, razor knife, knife or other cutting instrument with a pointed 2 in. (50 mm) minimum length blade, sealable sample bags, repair sealant compatible with existing sealant, tools for installing sealant, butyl tape, water.

6. Summary of Methods

6.1 *Nondestructive Method*—This method makes use of a blunt dowel shaped tool to impart pressure against the surface of the sealant bead. Firm pressure is applied to the surface of the sealant in the center of the bead and near the bond line.

6.2 *Destructive Method*—This method is performed by cutting through the sealant bead to provide either a “tail” or a “flap” of sealant that can be pulled by hand, to stress the bond line of the sealant. The width and location of the sealant bead will determine how and to what degree the hand pull method can be performed. This method uses described techniques to cause an adhesive failure from the substrate.

NOTE 4—Narrow joints (less than $\frac{5}{16}$ in. or 8 mm wide) do not lend themselves to destructive field adhesion tests. Usually, some kind of “tail” can be provided to perform an adhesion pull. However, these tests tend to evaluate the cohesive property of the sealant more than the adhesive property.

NOTE 5—Joints that are less than $\frac{5}{8}$ in. or 16 mm wide or that are more than $\frac{1}{2}$ in. (13 mm) deep do not lend themselves to a “flap” style adhesion pull. The “tail” style adhesion pull should be performed on these joints.

7. Procedures

7.1 Nondestructive Procedure:

7.1.1 Select a probing tool that is at least $\frac{1}{8}$ in. (3 mm) narrower than the width of the sealant joint to be evaluated. Fig. 1 provides example dimensions for a probing tool.

NOTE 6—The probing tool should be blunt without sharp edges and shaped in such a way that it will not puncture the sealant bead.

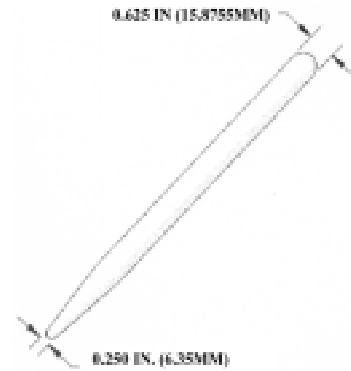


FIG. 1 Probing Tool

7.1.2 *Technique 1*—Using the probing tool, depress the center of the sealant bead to create an elongation strain on the sealant joint. Record the depth of the depression as a percentage of the width of the bead. A common percentage used to create reasonable strain and reveal poor adhesion is 50 %. The appropriate percentage varies with each sealant joint and is approximately proportional to the expected joint movement. The percentage can be correlated with destructive procedure test results.

7.1.3 *Technique 2*—Locating the probing tool adjacent to the sealant/substrate bond line, depress the sealant bead to the extent that (visually) it appears the sealant is about to fail cohesively. The sealant bead should be depressed in such a way that the probing tool does not contact or scrape against the substrate, nor slide toward the center of the joint. This technique will effect a peel-type strain on the sealant joint. This technique will produce shear forces close to the bond line and therefore the results should be prudently interpreted.

7.2 Destructive Procedure:

7.2.1 The “Tail” Procedure consists of cutting through the sealant, 6 in. (150 mm) along the bond line at both substrates. Cut across the sealant bead to release one end of the “tail” that is formed (see Fig. 2). Insure that the sealant is cut at the

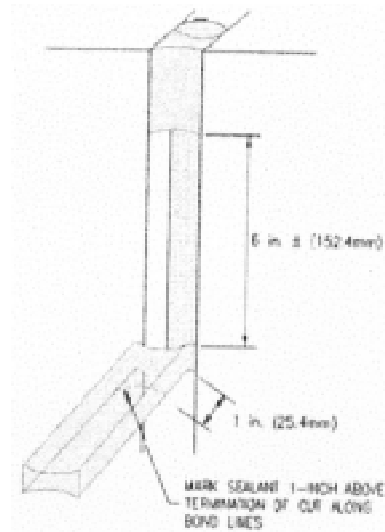


FIG. 2 Tail Procedure

substrate and that the sealant bead is free of nicks or jagged edges.

7.2.2 *Method A:*

7.2.2.1 Mark the cut portion of the sealant 1 in. (25 mm) from the adhesive bond.

7.2.2.2 Grasp the sealant “tail” at the mark 1 in. (25 mm) from the adhesive bond.

7.2.2.3 Pull tail at an angle of 90° to the substrate to effectively extend the 1-in. mark to two times the stated movement capability of the sealant.

7.2.2.4 Record the type of failure that occurred and the distance of the mark from the adhesive bond when failure occurred, or the distance recommended by manufacturer without causing failure.

7.2.3 *Method B:*

7.2.3.1 Mark the cut portion of the sealant 1 in. (25 mm) from the adhesive bond.

7.2.3.2 Grasp the sealant tail at the mark 1 in. (25 mm) from the adhesive bond.

7.2.3.3 Various tests can be performed pulling the tail slowly at an angle of 30, 90 or 150° to the substrate, keeping the tail in line with the sealant bead as nearly as possible. Monitor the extension to determine the elongation resulting in failure.

NOTE 7—Techniques using the “tail procedure” that allow evaluations of sealant adhesion to one substrate at a time are acceptable.

7.2.3.4 If the sealant begins to tear cohesively, stop pulling and readjust the grasp on the tail and begin pulling again. Pull on the tail in whatever direction or manner that best avoids cohesive tearing and encourages adhesive failure.

7.2.3.5 Repeat procedure as necessary to evaluate adhesion to both substrates forming the joint.

7.2.4 *Flap Procedure:*

7.2.4.1 The “Flap” Procedure consists of cutting through the sealant, 3 in. (76 mm) along the bondline on the substrate opposite to the substrate to be evaluated. Make two cuts across the sealant bead, one at each end of the 3 in. (76 mm) cut. Pry up the flap that is formed by the three cuts through the sealant bead (see Fig. 3).

7.2.4.2 Grasp the flap near the edge opposite the bond line to be evaluated.

7.2.4.3 Pull the flap in the tensile mode until adhesive or cohesive failure.

7.2.4.4 Stop pulling and grasp the flap near the other end.

7.2.4.5 Pull the flap in a shear mode until the onset of adhesive or cohesive failure.

7.2.4.6 Trim away the portions of the flap that have failed.

7.2.4.7 Bend, twist and/or rotate the flap until adhesive or cohesive failure occurs.

7.2.4.8 The Flap Procedure should be performed to evaluate the bond at each substrate, particularly if the substrates on either side of the joint vary.

7.3 *Number of Tests:*

7.3.1 The frequency of the testing depends upon the reasons for performing the test procedures; for example, to evaluate newly installed sealant as part of a Quality Control program, to evaluate aged sealant as part of a condition survey or to evaluate failing sealant as part of an investigation.

7.3.2 *Nondestructive Procedure*—For each area to be inspected, perform procedure every 12 in. (300 mm) for first 10 linear ft (3 m) of joint. If no test failure loss is observed in the first 10 linear ft (3 m) of joint tested, test every 24 in. (600 mm) thereafter.

7.3.2.1 After any observation of test failure, increase the frequency of the testing.

7.3.3 *Destructive Procedure*—For each area to be inspected, perform procedure every 100 linear ft in the first 1,000 linear ft of joint. If no test failure is observed in the first 1,000 ft of joint, perform procedure every 1,000 linear ft thereafter or approximately once per floor per elevation.

7.3.3.1 After any observation of test failure, increase the frequency of the testing. Correlate results with nondestructive procedure results.

7.3.4 Frequency of tests may be increased for either procedure for any reason or may be decreased if only spot-checking is desired. Test each joint condition as deemed necessary.

7.3.5 Testing at non-typical locations such as joint intersections and complex joint configurations is recommended.

7.4 *Water Exposure:*

7.4.1 The addition of exposure of the sealant bead to water can be added to any of the above procedures.

7.4.2 Water exposure can be achieved at installed weather-proofing sealant joints by creating a vessel attached to the substrate and sealant bead that can contain water. A prefabricated vessel, sized to expose the length of joint to be tested, can be adhered to the substrate and sealant bead using sealant or sealant tape. Water exposure should only be performed after the cure time recommended by the sealant manufacturer. The vessel top should be left open to allow placement of water.

7.4.3 The vessel should be filled with distilled water causing the face of the vessel to be completely filled with water. Seal the top of the chamber after filling to prevent evaporation. In cold climates, consideration should be given to protecting the chamber from freezing.

7.4.4 Remove the vessel and contents and perform the procedures described in 7.1-7.3.

8. Reporting

8.1 Record test conditions and results for each procedure on an appropriate form; (see Fig. 4, for example form).

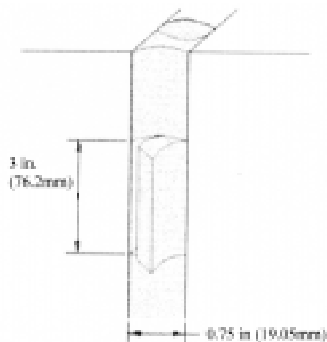


FIG. 3 Flap Procedure

**FIELD ADHESION REPORT FORM**

Date: _____
 Project: _____
 Test Area: _____
 Elevation: _____ Floor: _____
 Specific Location: _____
 Joint Width: _____ *Joint Depth: (at centerline) _____
 *Backer Rod Type: _____

**Information normally available on destructive evaluations only.*

PROBING TEST**Technique 1**

No.	Floor	Location	Sealant Age	Substrate	No Failure	Cohesive Failure	Adhesive Failure	Maximum Surface Depression (as % of joint width)

Technique 2

No.	Floor	Location	Sealant Age	Substrate	No Failure	Cohesive Failure	Adhesive Failure	Maximum Surface Depression (as % of joint width)

DESTRUCTIVE TESTS - TAIL PULL**Method A**

No.	Floor	Location	Sealant Age	Substrate	Elongation*	Failure Type			
						Adhesive	Cohesive	Cohesive Film	Other

*Extension Length (Distance from substrate to mark on sealant)

Method B

No.	Floor	Location	Sealant Age	Substrate	Elongation*	Extension Angle			Failure Type			
						30°	60°	90°	Adhesive	Cohesive	Cohesive Film	Other

*Extension Length (Distance from substrate to mark on sealant)

FIG. 4 Field Adhesion Report Form

FIELD ADHESION REPORT FORM

Date: _____ Project: _____ Page 2 of 2

DESTRUCTIVE TESTS - FLAP PULL

Tensile

No.	Floor	Location	Sealant Age	Substrate	Elongation*	Failure Type			
						Adhesive	Cohesive	Cohesive Film	Other

*Extension Length (Distance from substrate to mark on sealant)

Shear

No.	Floor	Location	Sealant Age	Substrate	Elongation*	Failure Type			
						Adhesive	Cohesive	Cohesive Film	Other

*Extension Length (Distance from substrate to mark on sealant)

Describe any other evaluation performed:

FIG. 4 Field Adhesion Report Form (continued)

8.2 Each sealant joint is unique. This uniqueness requires that the procedures described in this method be subjectively applied and/or modified for each test. Reproducibility will therefore vary due to the subjectivity of the method.

8.3 It is recommended that the owner retain the sealant samples in a sealed plastic bag labeled with the location from which the sample was removed, date removed, results of method and project identification. These samples should be stored in a secure identified location for the duration of the warranty period.

8.4 Photographs of test areas can be useful in studying and comparing adhesion results.

9. Repair

9.1 Contact the sealant manufacturer for specific recommendations for the repair of sealant damaged during field adhesion testing procedures.

10. Precision and Bias

10.1 Each sealant joint is unique. This uniqueness requires that the procedures described in this method be subjectively applied and/or modified for each test. Reproducibility will therefore vary due to the subjectivity of the method.



11. Keywords

11.1 adhesive failure; cohesive failure; field adhesion; flap;
probing tool; tail

ASTM International takes no position respecting the validity of any patent rights asserted in connection with any item mentioned in this standard. Users of this standard are expressly advised that determination of the validity of any such patent rights, and the risk of infringement of such rights, are entirely their own responsibility.

This standard is subject to revision at any time by the responsible technical committee and must be reviewed every five years and if not revised, either reapproved or withdrawn. Your comments are invited either for revision of this standard or for additional standards and should be addressed to ASTM International Headquarters. Your comments will receive careful consideration at a meeting of the responsible technical committee, which you may attend. If you feel that your comments have not received a fair hearing you should make your views known to the ASTM Committee on Standards, at the address shown below.

This standard is copyrighted by ASTM International, 100 Barr Harbor Drive, PO Box C700, West Conshohocken, PA 19428-2959, United States. Individual reprints (single or multiple copies) of this standard may be obtained by contacting ASTM at the above address or at 610-832-9585 (phone), 610-832-9555 (fax), or service@astm.org (e-mail); or through the ASTM website (www.astm.org).